
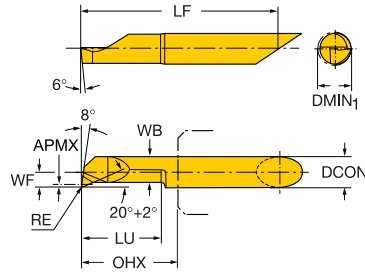


# CoroTurn® XS solid carbide tool for turning

## Turning

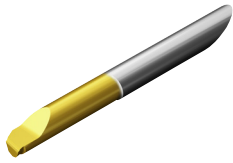

CZC <sub>MS</sub>	DMIN <sub>1</sub>	OHX	RE	APMX	CNCS	Ordering code	Material						Dimensions, mm, inch									
							P	M	N	S	H	1025	1025	HF05	1025	1025	HF05	7015	DCON	LU	LF	WF
7	7.2	43.0	0.20	0.5	0.0	CXS-07T098-20-7240R/L	☆	☆	☆	☆	☆						7	40.0	62.3	3.5	0.0	6.3
	.283	1.693	.008	.020	.000												.276	1.575	2.451	.136	.000	.246
7	7.2	48.0	0.20	0.5	0.0	CXS-07T098-20-7245R/L	☆	☆	☆	☆	☆						7	45.0	67.3	3.5	0.0	6.3
	.283	1.890	.008	.020	.000												.276	1.772	2.648	.136	.000	.246
7	7.2	53.0	0.20	0.5	0.0	CXS-07T098-20-7250R	☆	☆	☆	☆	☆						7	50.0	72.3	3.5	0.0	6.3
	.283	2.087	.008	.020	.000												.276	1.969	2.844	.136	.000	.246
7	7.2	28.0	0.20	0.9	0.0	CXS-07T098A20-7225R	☆	☆	☆	☆	☆						7	25.4	47.3	3.5	0.0	6.7
	.283	1.102	.008	.035	.000												.276	1.000	1.860	.136	.000	.262
7	7.2	33.0	0.20	0.9	0.0	CXS-07T098A20-7230R	☆	☆	☆	☆	☆						7	30.5	52.3	3.5	0.0	6.7
	.283	1.299	.008	.035	.000												.276	1.201	2.057	.136	.000	.262
7	7.2	43.0	0.20	0.5	0.0	CXS-07T098A20-7240R	☆	☆	☆	☆	☆						7	35.6	62.3	3.5	0.0	6.7
	.283	1.693	.008	.020	.000												.276	1.402	2.451	.136	.000	.262

CZC<sub>MS</sub> to correspond with CZC<sub>WS</sub> on adapter.

N = Neutral, R = Right hand, L = Left hand

