Flame-resistant Tubing

FS

For spot welding piping

Features

- Tubes which utilize a flame-retardant resin.
- Our line-up of products with increased inner diameters contributes to the increase in flow volume.
- Markings along the tubing as an insertion length indicator.

Product number table

Millimeter size type (Group 4)


1		Outer diameter × Inner diameter (mm)	working	Min. bending radius (mm)	Weight (g/m)	Standard color (color symbol)								
	Type					Black	White	Yellow	Blue	Green	Red	Light	Light	Pink
									-			LCM		
Ī	FS-4-4×2.5	4×2.5	1.0	10	10	•	0	0	0	•	•	-	-	-
	FS-4-6×4	6×4	1.0	15	21	•	0	0	0	•	•	0	-	_
	FS-4-8×5	8×5	1.2	15	40	•	0	0	0	•	•	_	_	_
1	FS-4-8×5.5	8×5.5	0.9	20	36	•	0	0	0	•	•	0	_	_
	FS-4-10×6.5	10×6.5	1.0	20	60	•	0	0	0	•	•	-	-	_
1	FS-4-10×7	10×7	0.9	25	55	•	0	0	0	•	•	0	o ²	•2
	FS-4-12×8	12×8	1.0	30	82	•	0	0	0	•	•	-	-	_
1	FS-4-12×8.5	12×8.5	0.9	30	77	•	0	0	0	•	•	0	o 2	•2
	FS-4-16×12	16×12	0.7	80	106	_	_	_	0 2	_	_	_	_	1_

^{*1} Insertion type fittings of QuickSeal series cannot be used for FS tubing because of different inner diameters.

Standard length

20M, 100M @ FS-4-16x12: 50M only

Product number example

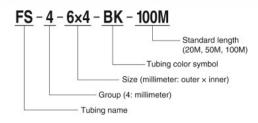

Insertion length markings

Markings along the tubing as an insertion length indicator.



Operating fluid, working temperature range

Operating fluid	Working temperature range				
Air	-40°C~+100°C				
Water	0°C~+70°C				


Negative pressure performance

-101.294kPa

Relation between the working temperature

The maximum working pressure varies with the working temperature (environmental temperature). For use at an abnormal temperature, always check the maximum working pressure change in the graph below and keep the pressure within the indicated range.

Caution: Using tubes at a pressure outside the range may cause accidents or damage, for which Nitta is not liable.

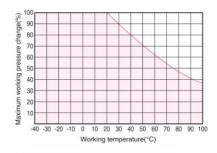

Handling instructions

Caution: When water is used as the operating fluid, the tubing material might degrade depending on the additive. Contact us for details.

Caution: When water is used as the operating fluid, keep the surge pressure below the maximum working pressure. Also, do not allow the water to freeze.

See page 10 for common instructions for tubing products.

Applicable fittings

PushOne A series

Durch Once Francisco









(*1) When QuickSeal series fittings are used on a spatter-resistant line, replace the nylon sleeve with a brass sleeve.

Related products and product introduction

Spatter cap



Reference

Flame test of UL-94 standardP.195 Effective sectional area ...P.168 Negative-pressure performance listP.169

² Made to Order